

TESLA provided the TNCAP rescue sheet on October 23, 2025



TESLA MODEL Y


From 2025—Present



5 doors / 5 seats / SUV







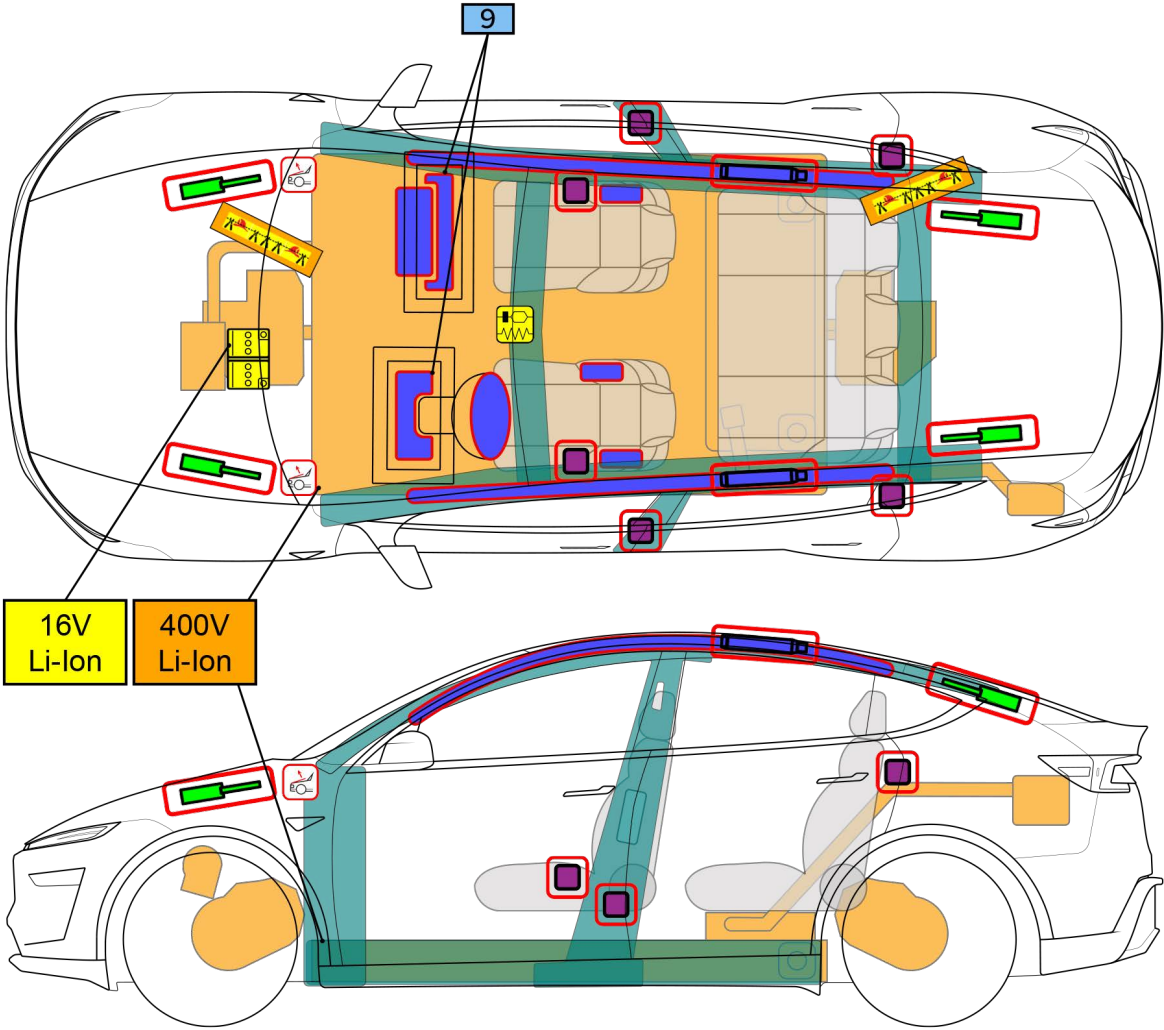

	Airbag		SRS control unit		Stored gas inflator		Seat belt pre-tensioner		Gas strut / Preloaded spring
	Battery low voltage		Battery pack, high-voltage		High voltage power cable		Cable cut		High strength zone
	Pedestrian protection active system								

TESLA Model Y
From 2025 - Present

ID No.

TESLA-2025MY-002

Version No.

02


Page No.

01/04

1. Identification / Recognition



LACK OF ENGINE NOISE DOES NOT MEAN VEHICLE IS OFF. SILENT MOVEMENT OR INSTANT RESTART CAPABILITY EXISTS UNTIL VEHICLE IS FULLY SHUT DOWN. WEAR APROPRIATE PPE.

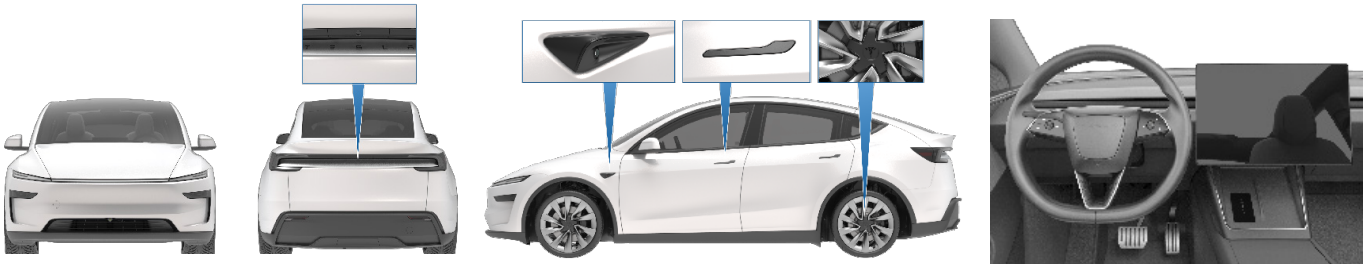

NOTE: The Tesla wordmark indicates a fully electric vehicle.
NOTE: The model name does not appear on the exterior of the vehicle.

2. Immobilization / Stabilization / Lifting

IMMOBILIZATION

1. CHOCK WHEELS




2. PUT VEHICLE INTO PARK POSITION



PUSH TO PARK

STABILIZATION / LIFTING POINTS

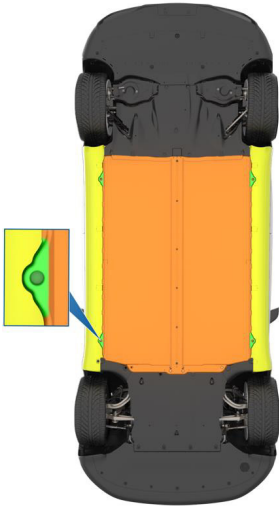

	Appropriate lift areas
	Safe stabilization points for Model Y resting on its side
	High Voltage (HV) Battery




Do not push on HV Battery.






3. Disable Direct Hazards / Safety Regulations

ACCESS

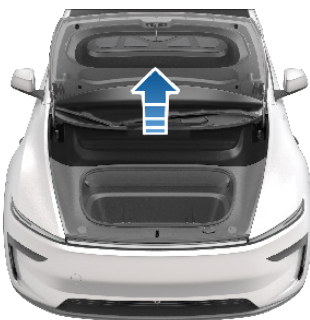


MAIN DISABLING METHOD

- Open the hood.
- Double cut the first responder loop.

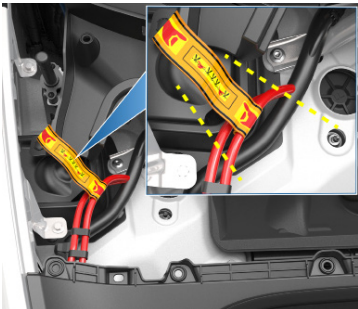

ALTERNATIVE DISABLING METHOD

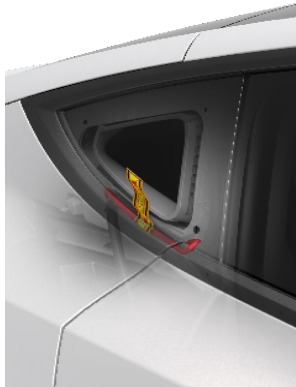

- First responder loop is located on the right side of Model Y.
- Break fixed window and remove trim to access.



Not every high voltage component is labeled. Always wear appropriate PPE. Always double cut the first responder loop. Do not attempt to open the high voltage (HV) battery.






4. Access to the Occupants


 Electrical and mechanical releases like doors and seat belts may be compromised after a collision.
 

NOTE: The seats, steering wheel, and interior door buttons are electrically powered and may not function after a collision.

NOTE: After a collision, the doors may not unlock from the outside. Extrication may be required. The body is constructed of steel with aluminum doors.



NOTE: The windshield, top glass, and rear window is made of laminated glass. The side windows can be either tempered or laminated glass.

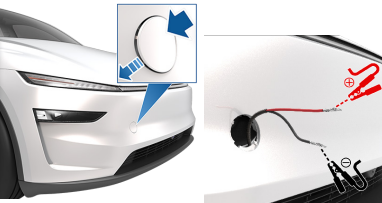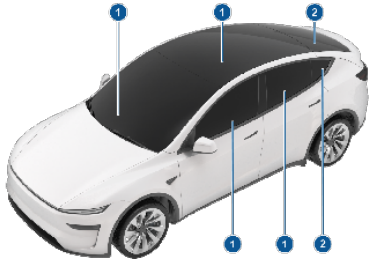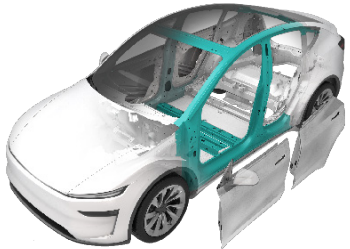OPENING DOORS FROM OUTSIDE WITH POWER 	OPENING DOORS FROM INSIDE WITH POWER 	OPENING TRUNK FROM OUTSIDE WITH POWER 	OPENING HOOD FROM INSIDE WITH POWER Touch the open hood button on the touchscreen 
OPENING FRONT DOORS FROM INSIDE WITHOUT POWER 	OPENING REAR DOORS FROM INSIDE WITHOUT POWER 	NON-OPERATIONAL WITHOUT POWER   	OPENING HOOD WITHOUT POWER Use external power supply to OPEN 
GLASS 1. LAMINATED 2. TEMPERED 		HIGH STRENGTH ZONES - STEEL VEHICLE STRUCTURE - ULTRA-HIGH STRENGTH STEEL A/B PILLARS - ALUMINUM DOORS 	

5. Stored Energy / Liquids / Gases / Solids

	   	16V Low Voltage	 All high voltage cables have ORANGE INSULATION.
	     	400V Li-Ion	

6. In Case of Fire

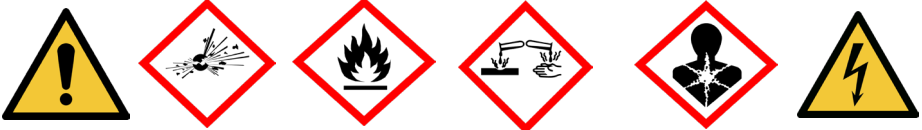

**DO NOT SUBMERGE VEHICLE TO EXTINGUISH/COOL BATTERY FIRE**

**USE LARGE AMOUNTS OF WATER TO COOL THE BATTERY ENCLOSURE FROM THE BOTTOM OF THE VEHICLE**

**POSSIBLE BATTERY RE-IGNITION!**

**MONITOR HV BATTERY TEMPERATURE FOR AT LEAST 24 HOURS**

7. In Case of Submersion

Treat a submerged Model 3 like any other submerged vehicle. Wear appropriate PPE for water rescue. Remove the vehicle from the water and continue with normal high voltage disabling. Vehicles submerged in water should be handled with a greater potential risk of an HV battery fire. Raise the front of the vehicle approximately 30 cm (1 foot) to allow water to drain out of the vehicle and battery pack and then store the vehicle flat.

8. Towing / Transportation / Storage

Use a towing truck with flatbed.
NO towing with running traction wheels.



**HV BATTERY TEMPERATURE SHOULD BE CHECKED BEFORE TRANSPORT**



POSSIBLE BATTERY RE-IGNITION!
AFTER A FIRE INCIDENT, STORE OUTSIDE AT A SAFE DISTANCE (AT LEAST 50 FT/ 15 M) FROM OTHER VEHICLES AND STRUCTURES!

9. Important Additional Information

First Responders and Second Responders with emergencies, call Tesla Roadside Assistance. Refer to <https://www.tesla.com/roadside-assistance> for the applicable hotline number.

First responder information can be found at <https://www.tesla.com/firstresponders>. First responders and training officers who have questions, contact firstrespondersafety@tesla.com.

Airbags:



Knee airbags are only installed in North America, excluding Mexico.

10. Explanation of Pictograms



In some working environments, the Infrared (IR) device is referred to as a Thermal Imaging Camera (TIC).